

# TECHNICAL BULLETIN


Friday, September 12<sup>th</sup>, 2025

800086-LED lights shipped during pre-season orders, specifically on and after August 2025 may experience lighting problems from an issue during production.

Arctic has discovered that Low beams and High beams were wired in reverse of what they should have been inside the headlight housing.

Dealers/End users may see High beam bulbs on the plow come ON when truck is on Low beam and the Low beam bulbs on plow come ON when the truck is on High Beam.

To rectify this problem, kindly interchange the Red (High beam) & Black (Low beam) wiring configuration on LED headlights plug shown below.

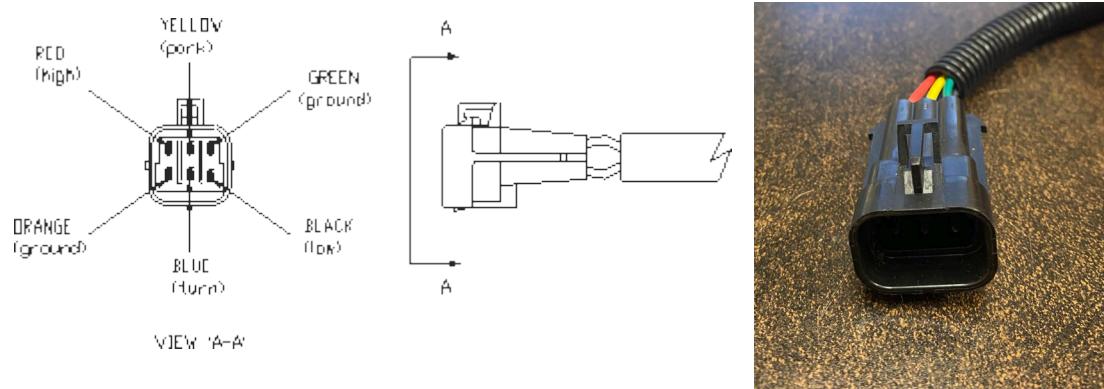

Arctic takes full responsibility for the inconvenience this may cause and will compensate for 30 mins of labor per set of LED headlights.

If you have any questions, please connect with your Sales rep or contact us at: (866) 757-1243, [web@arcticsnowplows.com](mailto:web@arcticsnowplows.com)